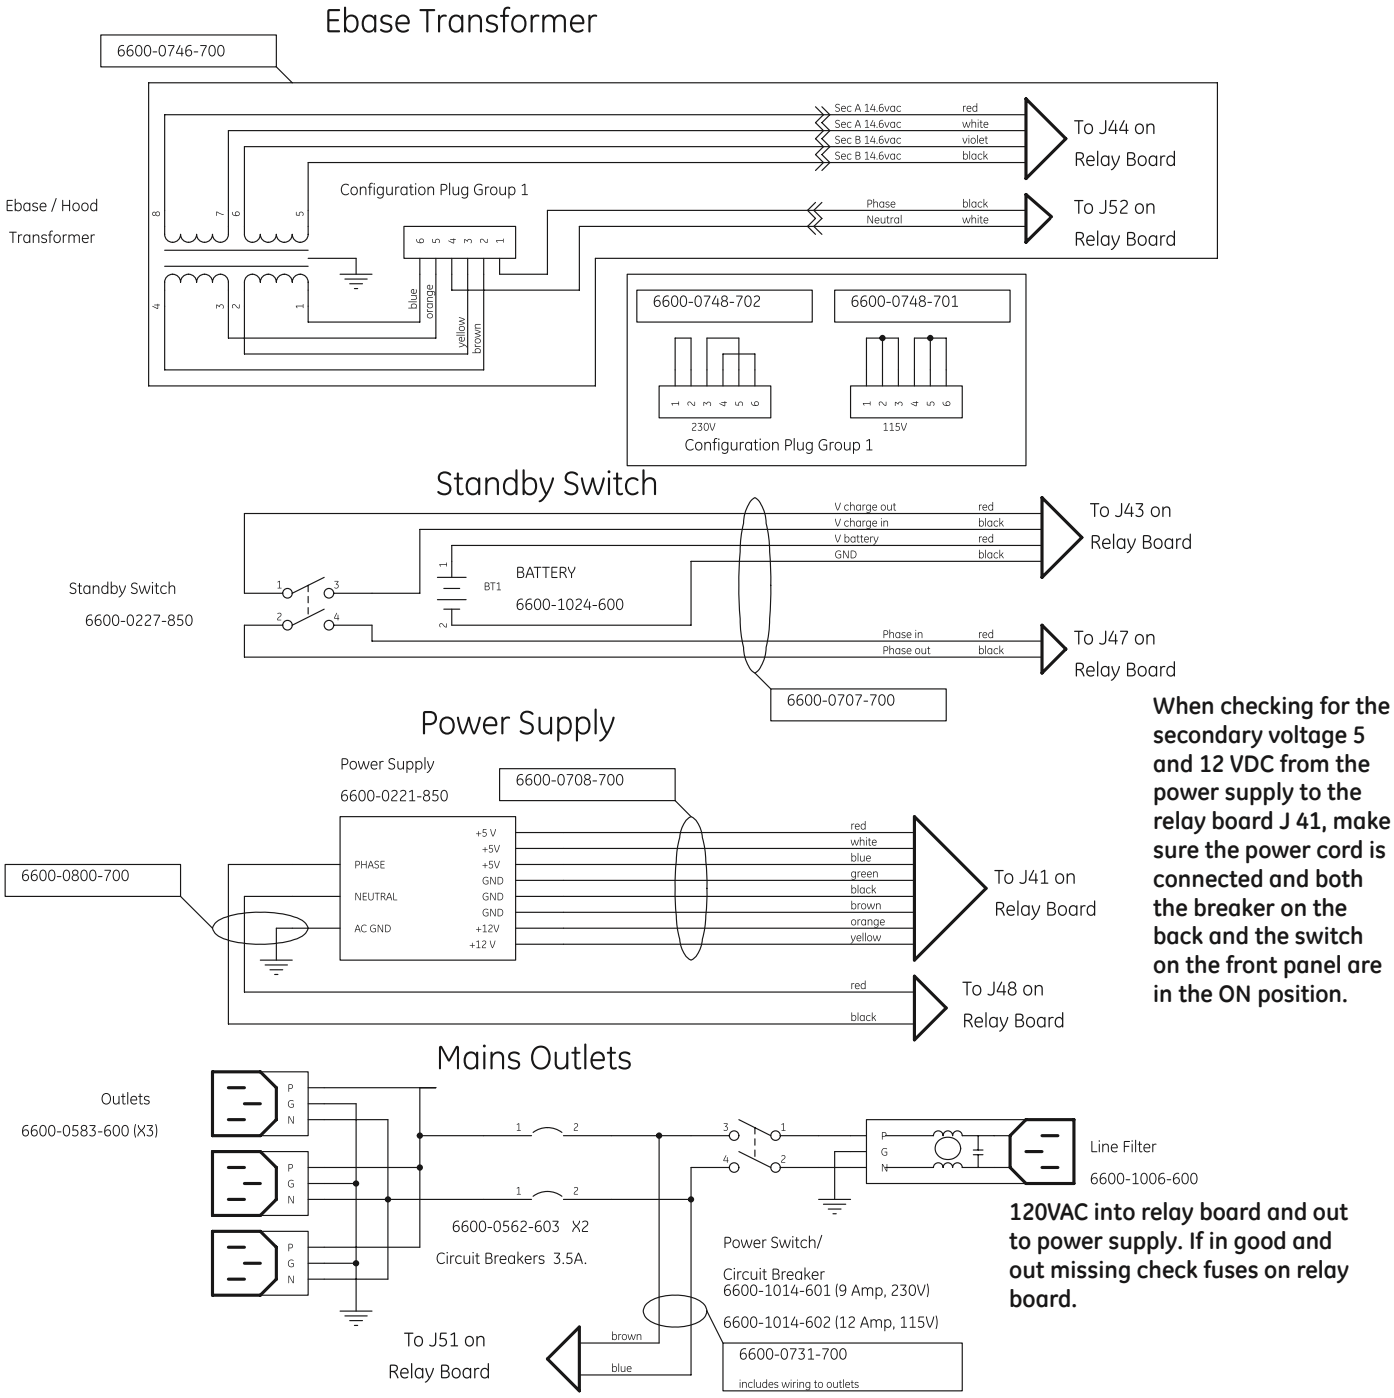

When checking for the secondary voltage 5 and 12 VDC from the power supply to the relay board J 41, make sure the power cord is connected and both the breaker on the back and the switch on the front panel are in the ON position.

120VAC into relay board and out to power supply. If in good and out missing check fuses on relay board.

Figure 6-38 Wiring Diagram: Electrical Enclosure

 © 2001 by Datex-Ohmeda, Inc.. All rights reserved.